 Tesla, Inc. Service Bulletin		Replace LH Body Controller, Model Y	
SB-22-17-014 August 15, 2022			
Classification		Section/Group	Mobile Service
Campaign Bulletin		17 - Electrical	Can Perform (where permitted)
Configuration			
All			
Model Year	Model	Country/Region	Build Location
2021 - 2022	Model Y	All	All
<small>The model(s) and model year(s) listed are a general approximation of the affected VIN list. Refer to the VIN/Bulletin Tracker or Customer/Vehicle profile to determine applicability of this bulletin for a particular vehicle.</small>			

Campaign Bulletin: This campaign bulletin addresses a non-safety-related condition and provides recommended technical diagnosis and repair procedures. Apply this procedure to the applicable vehicles.

Condition

Certain Model Y vehicles that received a tow hitch retrofit in Service may require a replacement LH Body Controller Module.

Correction


Replace the LH Body Controller Module with a tow-capable version.

Correction Description	Correction	Time
SB-22-17-014 Not Applicable	S012217014	0.00
Replace LH Body Controller, Model Y	S022217014	0.45

Part Number	Description	Quantity
Parts Required 1497847-10-D	ASY. LEFT ECU GEN 3, 5 SEAT, TOW	1
Or:		
1497847-02-D	ASY. LEFT ECU GEN 3, 7 SEAT, TOW	1
<small>These part numbers were current at the time of publication. Use the revisions listed or later, unless otherwise specified in the Parts Catalog.</small>		
Special Tools 1103278-01-A	TOOL, TRAILER LIGHT TESTER	

Procedure

1. Replace the LH Body Controller Module with the correct tow-capable LH Body Controller Module for the vehicle configuration (refer to Service Manual procedure [17152102](#)).
2. Use the Trailer Light Tester to test the trailer light connector (refer to Toolbox article [30973](#)).

 **NOTE:** If the Trailer Light Tester is not available, use a bike rack with lights, a trailer light kit or other equipment as an alternative testing method.